

**EASA FORM 1**

4. Organisation Name and Address: **GOODRICH CUSTOMER SERVICES, INC - DUBAI MRO**  
 OPERATING AS UFG AIRCRAFT SYSTEMS  
 Plot No: 800624, 08 & 10, RD-36 RM, P.O. BOX 17699,  
 JEBEL ALI FREE TRADE ZONE SOUTH, DUBAI, UNITED ARAB EMIRATES  
 TEL: 971-4-8101500, FAX: 971-4-8101692


6. Item	7. Description	8. Part No.	9. Qty.	10. Serial No.	11. Status/Work
01	Dr 3 Type A Sidelraft LH	4A3034-11	1	AK0106	OVERHAULED

12. Remarks  
 Work Completed: Sidelraft Assy Overhauled IAW CMM 25-62-23 Rev 10 Dated 12 JAN 2018. Sidelraft Assy. DOM: SEP 2016.  
 Sidelraft's carried out during this visit Nil.  
 Reservoir Assy P/Ns 5A2274-5 S/Ns IZ 7824. Reservoir Assy next Overhaul dup: MAR 2021.  
 Cylinder P/Ns 630124-05 DOM: JUN 2006 EXP: JUN 2021 Current HST Date: MAR 2018 Next HST Due Date: NA.  
 Survival Replacement Kit P/Ns 5A2025-57 DOM: FEB 2019, EXP: FEB 2023.  
 Survival Base Kit P/Ns 5A2925-59 DOM: JUL 2014, EXP: JUL 2024.  
 Sidelraft Assy Next Overhaul Due Date: MAR 2021. TSO: Zero Hours. GSO: Zero Cycles.  
 "Refer attached Repair-Work Record for disposition of removed like limited items and replaced parts"

13a. Certifies that the items identified above were manufactured in conformity  
 approved design data and are in a condition for safe operation  
 non-approved design data specified in block 12

14a.  Part 145 A.50 Release to Service  Other regulation specified in block 12  
 Certifies that unless otherwise specified in block 12, the work identified in block 11 and described in block 12, was accomplished in accordance with Part 145 and in respect to that work the items are considered ready for release to service.

13b. Authorised Signature  
 13c. Date (dd mm yyyy)  
 14b. Authorised Signature  
 14c. Certificate / Approval Ref. No.  
 14d. Name  
 14e. Date (dd mm yyyy)

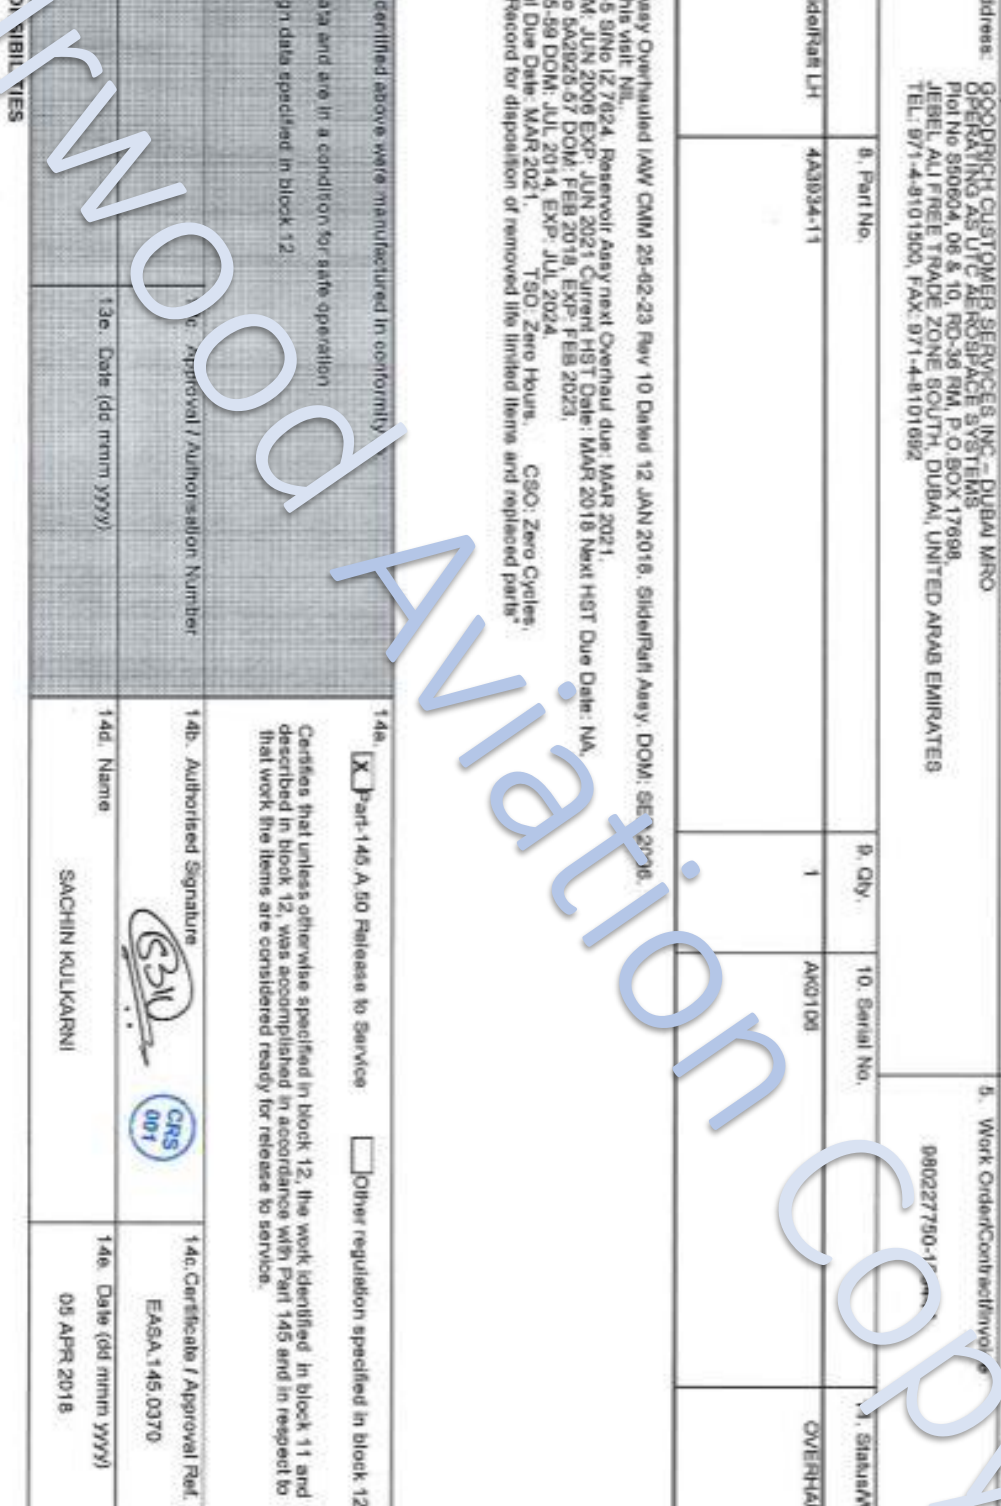

**USER / INSTALLER RESPONSIBILITIES**

This certificate does not automatically constitute authority to install the item(s).  
 Where the user/installer performs work in accordance with regulations of an airworthiness authority different from the airworthiness authority specified in block 1, it is essential that the user/installer ensures that he/she has the airworthiness authority specified in block 1.  
 Statements in blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.

CSV Dubai MRO  
 Goodrich Customer Services  
 PO Box 17698, Jebel Ali Free  
 Trade Zone  
 — DUBAI  
 UTD 3008 EMIR.  
 Printed on 05.04.2018 11:38:01

# REPAIR WORK RECORD



<b>Sales Order / Item</b> 5943836/1000		<b>Date Recd</b> 12.03.2018	<b>Part Number</b> 4A3934-11		<b>Description</b> Dr 3 Type A Slide/Raft LH	
<b>SM Order</b> 42245525	<b>Serv Nbr / No</b> 302776673	<b>Qty</b> 1.000	<b>Quote date</b> 22.03.2018	<b>Accept Date</b> 05.04.2018	<b>Ship Date</b>	<b>In Serial No</b> AK0106
<b>Cust Nbr</b> CP2205	<b>Cust Name</b> GOODRICH AEROSPACE SERVICES SAS		<b>Cust PO</b> 980227750-109444		<b>Cust Part No</b>	
<b>Work Scope:</b> OVERHAUL			<b>Output part :</b> 4A3934-11		<b>Output Serial :</b> AK0106	
<b>Removal Code:</b> OVHL OVERHAUL				<b>Status/Work:</b> OVERHAULED		
<b>Aircraft</b> Unknown	<b>Engine Type</b> Unknown	<b>Tsn Nbr</b> Unknown	<b>Customer Serial Nbr</b> Unknown		<b>DOM</b> 20.09.2006	

## Preliminary Inspection

Customer Work scope: Overhaul  
 Proposed Work scope: Overhaul  
 Certificates Required: EASA Form 1 & FAA 8130-3  
 Customer Comments: Overhaul  
 Warranty: Nil

### \* SLIDE RAFT ASSY

Slide Raft Assy requires Overhaul IAW CMM 25-62-23 Rev: 10 Dated: 12 Jan 2018

Condition upon Receipt: Packed

Electrical Test: Satisfactory

### Damaged Parts:

1. Replacement kit P/N: 5A2925-57 Qty: 01 found less serviceable life requires replacement.
2. Knife Assy P/N: 880195 Qty: 01 Found crack requires replacement.
3. Top soft cover found cut requires repair.
4. Pack board Velcro retainer P/N: 1408-500 Qty: 02 found torn out requires replacement.
5. Pack board found puncture in 3 places requires repair.
6. Pack board found delamination in 3 places requires repair.
7. Pack board Decal P/N: 2A1950-2 Qty: 01 need to be remove for pack board repair requires replacement.

Missing Parts: None

Applicable SBs: Nil  
 Applicable ADs: Nil

CSV Dubai MRO  
Goodrich Customer Services  
PO Box 17698, Jebel Ali Free  
Trade Zone  
— DUBAI  
U.A.E. ARAB EMIR.

# REPAIR WORK RECORD



**UTC Aerospace Systems**

Printed on 05.04.2018 10:35:19

Page 2 of 4

Sales Order / Item	Date Recd	Part Number	Description			
3943836/1020	12.03.2018	4A3934-11	Dr 3 Type A Slide/Raft LH			
SM Order	Serv Notif No	Qty	Quote date	Accept Date	Ship Date	In Serial No
42545525	302738673	1.000	22.03.2018	05.04.2018		AK0106

Applicable SNLs: Nil

### \* RESERVOIR ASSEMBLY

RESERVOIR ASSEMBLY REQUIRES HST AND OVERHAUL IAW CMM 25-62-31.Rev 03, Date 13 APR 2017.

Applicable SBs: Nil

Applicable ADs: Nil

Applicable SNLs: 25-25

#### FINDINGS:)

- 1) Retaining Ring(1A2466) & O-ring(825138) needs to be replaced.
- 2) fuse plug (3A3880-1) found damaged requires replacement.
- 3) charging valve(2A1926-1) found unserviceable requires replacement.
- 4) aluminium decal(2A1807-1) found damaged requires replacement.

### \* ASPIRATOR ASSEMBLY

ASPIRATOR ASSEMBLY RECEIVED FOR INSPECTION AND TESTING IAW CMM 25-62-30. REV 03 DATED 30 SEP 2015

Applicable SBs: Nil

Applicable ADs: Nil

Applicable SNLs: Nil

FINDINGS: NONE

### Internal Traceability

#### RESERVOIR ASSEMBLY

RESERVOIR ASSEMBLY REQUIRES HST AND OVERHAUL IAW CMM 25-62-31.Rev 03, Date 13 APR 2017.

RESERVOIR ASSEMBLY P/N: 5A3274-5

RESERVOIR ASSEMBLY S/N: IZ 7624

RESERVOIR ASSEMBLY DOM: Sep-2006

CYLINDER P/N: 630124-05

CYLINDER DOM: Jun-2006

CYLINDER EXPIRY DATE: Jun-2021

CURRENT HST: Jan-2015,H469

REGULATOR VALVE P/N: 4A3857-4

REGULATOR VALVE S/N: N-1645



CSV Dubai MRO  
 Goodrich Customer Services  
 PO Box 17698, Jebel Ali Free  
 Trade Zone  
 — DUBAI  
 U.A.E. ARAB EMIR.  
 Printed on 05.04.2018 11:44:01

# REPAIR WORK RECORD



**UTC Aerospace Systems**

<b>Sales Order / Item</b> 5943826/1020		<b>Date Recd</b> 12.03.2018	<b>Part Number</b> 4A3934-11		<b>Description</b> Dr 3 Type A Slide/Raft LH	
<b>SM Order</b> 42245525	<b>Serv Notif No</b> 302738673	<b>Qty</b> 1.000	<b>Quote date</b> 22.03.2018	<b>Accept Date</b> 05.04.2018	<b>Ship Date</b>	<b>In Serial No</b> AK0106

REGULATOR VALVE DOM: Aug-2006

**FINDINGS:**

- 1) Retaining Ring(1A2466)& Cable tie(825138)needs to be replaced.
- 2) fuse plug (3A3880-1)found damaged requires replacement.
- 3) charging valve (2A1926-1)found unserviceable requires replacement.
- 4) aluminium decal(2A1807-1) found damaged requires replacement.

**Note:** SNL 25-251 to be carried out on the unit IAW SNL 25-251 Rev Orig. 21 Oct 2015.

**\* ASPIRATOR ASSEMBLY**

ASPIRATOR ASSEMBLY RECEIVED FOR INSPECTION AND TESTING IAW CMM 25-62-30. REV 03 DATED 30 SEP 2015.

ASPIRATOR P/N: 5A3265-14  
 ASPIRATOR S/N: N-954 & N-972  
 ASPIRATOR DOM: 08-06

FINDINGS: NONE

**Work Performed**

**Damaged Parts Work Completion Report:**

1. Replacement kit P/N: 5A2925-57 Qty: 01 found less serviceable life replaced with new one.
2. Knife Assy P/N: 880195 Qty: 01 Found crack replaced with new one.
3. Top soft cover found cut repair carried out.
4. Pack board Velcro retainer P/N: 1408-500 Qty: 02 found torn out replaced with new one.
5. Pack board found puncture in 3 places repair carried out.
6. Pack board found delamination in 3 places repair carried out.
7. Pack board Decal P/N: 2A1950-2 Qty: 01 need to be removed from pack board repair replaced with new one.

**Work Completion Report For Reservoir Assembly**

1. All overhaul parts, CHARGING VALVE P/N:2A1926-1,ALUMINIUM DECAL P/N:2A1807-1, AND PLUG FUSE P/N:3A3880-1 PARTS REPLACED. SNL 25-251 Rev Orig Dt 21 OCT 2015 Complied.

Work Completed: Slide/Raft Assy Overhauled IAW CMM 25-62-23 Rev 10 Dated 12 JAN 2018. Slide/Raft Assy. DOM: SEP 2006.

CSV Dubai MRO  
 Goodrich Customer Services  
 PO Box 17698, Jebel Ali Free  
 Trade Zone  
 -- DUBAI  
 U.A.E. ARAB EMIR.  
 Printed on 05.04.2018 10:35:19

# REPAIR WORK RECORD



**UTC Aerospace Systems**

<b>Sales Order / Item</b> 6943953/1020	<b>Date Recd</b> 12.03.2018	<b>Part Number</b> 4A3934-11	<b>Description</b> Dr 3 Type A Slide/Raft LH			
<b>SM Order</b> 42245525	<b>Serv Notif No</b> 302738673	<b>Qty</b> 1.000	<b>Quote date</b> 22.03.2018	<b>Accept Date</b> 05.04.2018	<b>Ship Date</b>	<b>In Serial No</b> AK0106

Work/AD's carried out during this visit: NIL.  
 Reservoir Assy P/No 5A3274-5 S/No IZ 7624. Reservoir Assy next Overhaul due: MAR 2021.  
 Cylinder P/No 630124-05 DOM: JUN 2006 EXP: JUN 2021 Current HST Date: MAR 2018 Next  
 HST Due Date: NA.  
 Survival Replacement Kit P/No 5A2925-57 DOM: FEB 2018, EXP: FEB 2023.  
 Survival Base kit P/No 5A2925-59 DOM: JUL 2014, EXP: JUL 2024.  
 Slide/Raft Assy Next Overhaul Due Date: MAR 2021.  
 TSO: Zero Hours. CSO: Zero Cycles.

<b>Author :</b> <b>Print name :</b> NA <b>Signature :</b> <b>Date :</b>	<b>Authorized Approval :</b> <b>Print name :</b> SACHIN KULKARNI <b>Signature :</b> <b>Date :</b> 05 APR 18
--	--