

1. Approving Competent Authority / Country: **2.** **AUTHORISED RELEASE CERTIFICATE**
 EASA FORM 1

3. Form Tracking Number: **37992154 - 01**

4. Organisation Name and Address: **KONINKLIJKE FABRIEK INVENTUM B.V.**
DOING BUSINESS AS
B/E AEROSPACE

5. Work Order/Contract/Invoice: **37992154 SR**
110191

6. GALVANIBAAN 5
 3439 MG NIEUWEGEIN
 THE NETHERLANDS

7. TEL.: +31 (0) 3060292200
 FAX: +31 (0) 3060300449
 TRADE REGISTER NO. 30001132

6. Item: **7. Description**

1.0: **DF110 LH Convection oven**

8. Part No.: **4310000-00-05**

9. Qty: **1**

10. Serial No.: **N09020106020449**

11. Status/Work: **MODIFIED**

12. Remarks:

Work performed in accordance with CMM: 25-32-11 Revision: 16
 Sub-component with P/N: 438000002 and S/N: N09020106044810
 Shop finding report ref.: 37992154

Performed: SB_110-25-0005; SB_OCMT10-25-0006
 The work identified in Block 11 and described herein has been accomplished in accordance with 14 CFR part 43 and TCCA CAR 673. In respect to that work, the items are approved for return to service under FAA certificate no. RY9393X and TCCA certificate no: 815-16.

13a. Certifies that the items identified above were manufactured in conformity to:

approved design data and are in condition for safe operation

non-approved design data specified in block 12

14a. PART -140.A.50 Release to Service

Other regulation specified in block 12

Certifies that unless otherwise specified in block 12, the work identified in block 11 and described in block 12, was accomplished in accordance with PART-145 and in respect to that work the items are considered ready for release to service.

13b. Authorised Signature

13c. Approval/Autorisation Number

13d. Name

14b. Authorised Signature

Electronic Signature on File

14d. Name

B/E AEROSPACE

QC 010


14c. Certificate/Approval Ref. No.

NL.145.1150

14e. Date (dd mmn yyyy)

14f. Date (dd mmn yyyy)

USER/INSTALLER RESPONSIBILITIES: The user/installer is responsible for ensuring that the user/installer performs works in accordance with the regulations of an airworthiness authority different than the airworthiness authority specified in block 1. It is essential that the user/installer ensure that his/her authorisation authority accepts items from the airworthiness authority specified in block 1. Statements in blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.

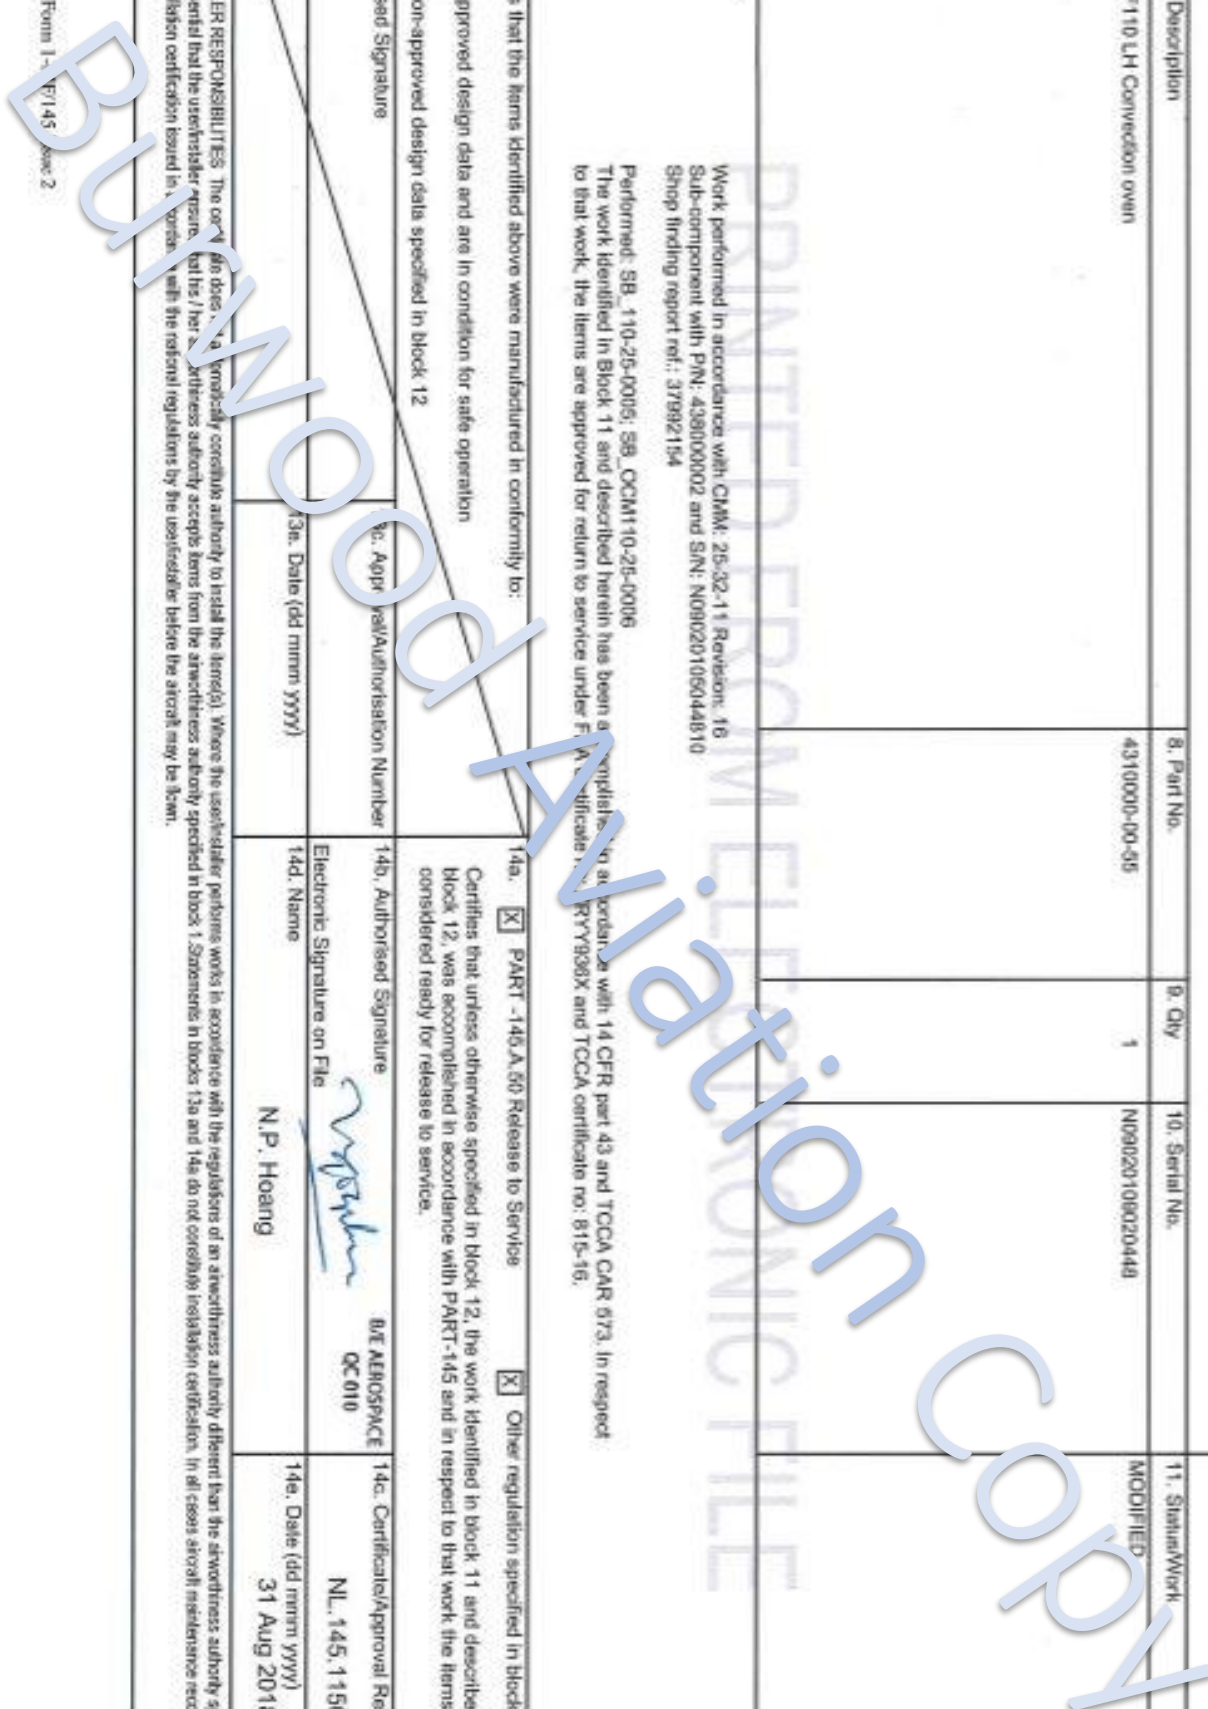



Passion to Innovate.
Power to Deliver.

SHOPFINDING REPORT

B/E Aerospace, Inc.
3439 MG Newswegain
The Netherlands
Office +31 (0)30 6039200
Fax +31 (0)30 6036649
repair_nieuwegein@benaerospace.com
beaerospace.com

Order details	REPAIR ORDER: 37992154	CUSTOMER: BURWOOD AVIATION SUPPLIES LTD	RECEIVING DATE: 14/05/2018
	WORK ORDER: 9894526	PURCHASE ORDER: 110191	

Repair details

REMOVAL REASON: FAILURE REASON: Unserviceable Motor 80-15-6PX KMP - Nolley - Friction	OUTGOING ITEM P/N: 4310000-00-55 S/N: N09020109020448	MODIFICATION Mod/ANDT In: N/A Mod/ANDT out: A	FAILURE VERIFIED: NOT VERIFIED
INCOMING ITEM P/N: 4310000-00-55 S/N: N09020109020448	OUTGOING SUB-ITEM Sub P/N: 438000002 Sub S/N: N09020105044810 Manufacturing date: 06/Feb/2009	REPAIRED AND TESTED IN ACCORDANCE WITH CMM: 25-12-11 Revision: 6	SUSPECTED UNAPPROVED PARTS SUSP: No

Shop findings

QTY	PART NUMBER	DESCRIPTION	DISCREPANCY / REASON / ACTION
14.00	234505	SEAL, DOOR SLIC,	Bad Condition / Not in spec / Replaced
1.00	237241	SEAL, HEATING BLANKET	Bad Condition / Not in spec / Replaced
1.00	239388	SAFETY DEVICE, 3 PHASE	Defective / Open circuit / Replaced
0.00	240349	Motor 80-15-6PX KMP	Nolley / Open circuit / Information only
1.00	240605	YAW	Nolley / Fan imbalance / Replaced
1.00	431009004	DOOR, DP110	Cracked / Unknown cause / Replaced
1.00	609773	COVER, INNER - DOOR	Bad Condition / Wear and tear / Replaced
1.00	611132	KNIBBENT, HEATING- ASSEMBLY	Insulation resistance too low / Replaced
1.00	CS-201-404	MOTOR, ELECTRO-	Insulation / As part of a Service Bulletin / Placed
7.00	CS-224-17	CABLE LHM, KI M3.5, TIN ,RED	Bad Condition / Overheating / Replaced
1.00	CS-641-08	O-RING, 9.25X1.78	Bad Condition / Heat and tear / Replaced
1.00	CS-901-01	LATCH, QUARTER ITEM, CRATED	Bad Condition / Heat and tear / Replaced
1.00	CS-936-02	PLUG, Ø 30	Missing / (Unknown Reason) / Placed

Modifications

MODIFICATION	REASON	STATUS

Form	Department	Email	Shopfinding report approved by	Date:	Name:	Signature:	Q.C. Dept:	Page
AM-400-DOC-01	Repair location	repair_nieuwegein@benaerospace.com		31 Aug 2018	M.P. Hoang		B/E AEROSPACE QC 010	1 of 2



Passion to Innovate.
Power to Deliver.

SHOPFINDING REPORT

B/E Aerospace, Inc.
Gaitherburg, MD
3639 MG Newwiegish
http://bepartners.com
Office: (410) 330 6029/200
Fax: (410) 330 6036/249
Email: shopfind@bepartners.com
http://shopfind.bepartners.com

Order details

REPAIR ORDER: 37992154 CUSTOMER: BURWOOD AVIATION SUPPLIES LTD RECEIVING DATE: 10/AUG/2018
WORK ORDER: 9894526 PURCHASE ORDER: 110191

Modifications

MODIFICATION	REASON	STATUS
INCOMING ITEM: BIB_110-25-0005 - Introduction of a new AC motor (and A)	Repair automatically includes new bib	Implemented
INCOMING ODM ITEM: BIB_OCM110-25-0006 - Introduction of a new software version (v1.10)	Recommended	Implemented

Remarks

Shopfinding report approved by

Form	Department	Email	Date:	Name:	Signature:	O.C. Dept:	Page
AM-400-DCC-001_01	Repair station	repair_nieuwegein@aerospac.com	31 Aug 2018	M.P. Hoang		B/E AEROSPACE QC 010	2 of 2