

1. Approving Competent Authority/Country
CAA / United Kingdom

2.

AUTHORISED RELEASE CERTIFICATE
EASA FORM 1

3. Form Tracking Number
ARC46849

4. Organisation Name and Address



Oakenhurst Aircraft Services Ltd
Claydon's Lane
Rayleigh, Essex
SS6 7UP
United Kingdom

Tel: +44 (0)1288741622
Fax:
Email: sales@oakenhurst.com
Web: www.oakenhurst.com

WP45505 / 110451

5. Work Order/Contract/Invoice

6. Item	7. Description	8. Part No.	9. Qty.	10. Serial No.	11. Status/Work
1	Retractable Landing Light	4315542	1	53267	Repaired

12. Remarks

The work identified in Block 11 and described herein has been accomplished in accordance with 14 CFR part 43 and in respect to the work the items are approved for return to service under certificate no. OSKYY452Y.
Work as stated in box 11 has been carried out in accordance with manufacturers manual No. 33-42-12, Rev 12 & 103/15.

13a. Certifies that the items identified above were manufactured in conformity with:	13a. <input checked="" type="checkbox"/> Part-145, A.50 Release to Service	13a. <input checked="" type="checkbox"/> Other regulation specified in block 12
<input type="checkbox"/> Approved design data and are in conformity with the design data		
<input type="checkbox"/> Non-approved design data specified in block 11		
13b. Authorised Signature	13c. Approval/Authorisation Number	14b. Authorised Signature
		<i>Billy Lander</i>
13d. Name	13e. Date (dd mmm yyyy)	14c. Certificate/Approval Ref. No.
		UK.145.00524
		14d. Name
		Mr Billy Lander
		14e. Date (dd mmm yyyy)
		28 Nov 2018

USER/INSTALLER RESPONSIBILITIES
This certificate does not automatically constitute authority to install the item(s).
The user/installer performs work in accordance with regulations of an airworthiness authority specified in block 1.
Items for the airworthiness authority specified in block 1.
Items in blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.



Oakenhurst Aircraft Services Ltd
 Claydons Lane
 Rayleigh, Essex
 SS6 7UP
 United Kingdom
 Tel: +44 (0)1268741622

EASA Part 145, UK.145.00524

FAR 145: O5KY452Y

Workshop Report

No: **IR45342**

Issue: **06**

Date: **03-Oct-18**

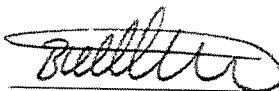
Burwood Aviation Supplies Limited Burwood House 8 Bessemer Close Verwood Dorset BH31 6AZ United Kingdom			
Attn: - Tel: 0044 (0) 1202 825434 Fax: 0044 (0) 1202 803416 E-Mail: repairs@burwood.aero			
Your Ref: 110451	Our Ref no: WP45505	Test Required: N/A	
Part No: 4315542	Description: Retractable Landing Light	TSN: N/A	CSN: N/A
Serial No: 53267	Workscope: FP&E-M Repair	TSO: N/A	CSO: N/A
DoM:	Overhauled:	Inspected:	
Removed From:	Serial No:	Reg No:	Position:

Inspection Findings:

Unit received for overhaul in average condition, with no stated defect. Bench tests carried out, unit failed to illuminate due to fault harness assy. Unit disassembled, inspection found unit heavily contaminated with dirt and screws worn and corroded. Unit requires further disassembly, replacement of overhaul and repair parts, cleaning, reassembly and full final testing IAW CMM 33-42-12, Rev 12, 4/03/15.

Customer has requested for unit to be repaired and not to be overhauled. Unit requires replacement of lamp harness as this caused the unit to not illuminate. Inspection carried out, four seals worn, Grommet worn and shock absorber worn. Unit requires replacement of parts, reassembly, cleaning and final testing IAW CMM.

Unit has been cleaned, reassembled, replacement of parts and final test carried out.

Signed:  Name: B. VANDER Date: 28/11/18

For and on the behalf of Oakenhurst Aircraft Services Ltd

Registered address:- Claydons Lane, Rayleigh, Essex, SS6 7UP